

APPENDIX D: TOP 20 BMP SITES

Site	Location	Direct Flow to	Land Use	Issues	Recommendations	Impact High = 3 Med = 2 Low = 1	Cost High = 3 Med = 2 Low = 1	Technical Level
1-18	Ossipee Mtn Rd. #446	Stream	Town Road	Unstable inlet and outlet; undersized culvert, moderate road shoulder erosion	Armor the inlet and outlet of the culvert and enlarge culvert (or build bridge). Build up road.	2	2	High
1-19	Wool Wakefield #23	Vegetation	Town Road	Slight ditch erosion and winter sand build-up.	Remove grader and winter sand.	1	1	Low
1-58	Blake Road by School	Vegetation/Wetland	Municipal/Public	Moderate surface erosion and a bare uncovered pile of soil.	Add mulch/erosion control mix and a rain garden.	2	2	Low
1-26	Blueberry Lane (end of Road)	Lake	Private Road	Slight surface erosion.	Build-up existing berm.	2	1	Medium
1-08	Sheridan Road near House #65	Vegetation	Town Road	Bank failure in the ditch and slight road shoulder erosion.	Armor the inlet of the culvert and remove the log. Reshape ditch and install turnouts on the East side.	1	2	High
1-12	Sheridan Road near Town Line	Wetland	Agriculture	Lack of shoreline vegetation, and cattle access to the waterbody (agricultural pond).	Establish buffer around the pond.	3	3	Low
1-14	Whittier Highway across from Moultonborough Self storage	Lake	Boat Access/State Road	Slight surface erosion from gravel road to lake without a buffer.	Add new surface material. Add apron of pavement on the slope near the highway and then add recycled asphalt to the bottom of the road near Berry Pond. Install a rubber razor at the steep slope of the road.	2	2	High
1-13	House #75	Ditch	Residential	Moderate road shoulder erosion in the driveway.	Vegetate shoulder and the slope to the ditch.	1	3	High

Site	Location	Direct Flow to	Land Use	Issues	Recommendations	Impact High = 3 Med = 2 Low = 1	Cost High = 3 Med = 2 Low = 1	Technical Level
2-02	Paradise Drive	Stream	Town Road	Culvert misaligned.	Replace culvert and add to the vegetated buffer.	3	2	High
1-16	Evans Road	Stream	Town Road	Unstable inlet and slight road shoulder erosion.	Vegetate shoulder and add guardrail.	1	2	Medium
2-07	Severance Road	Stream	State Road	Severe road shoulder erosion.	Vegetate the shoulder and create a gentler slope.	3	3	Low
1-03	Holland Road at Weed Brook Crossing	Stream	State Road	Slight surface erosion	Vegetate area between road shoulder and stream bank.	1	2	Low
2-04	Balmoral Beach	Lake	Beach Access	Shoreline erosion, slight surface erosion.	Define and stabilize foot path; add mulch/erosion control mix	1	1	Medium
1-60	Lee Road	Stream	Town Road	Moderate surface erosion and moderate road shoulder erosion near the culvert.	Armor the inlet and the outlet of the culvert.	2	1	High
1-06	Parking lot West of Town Hall	Wetland	Commercial	Slight road shoulder erosion at edge of lot.	Install rain garden at the north end of the parking lot.	2	2	Low
1-20	Ossipee Mtn Rd. near Interstate Governor Wentworth	Stream	Town Road	Culvert is too short and road drops right off into the stream.	Lengthen culvert and build up the road. Extend the culvert and widen the road.	1	2	High
1-02	Holland Road - Weed Brook Crossing	Stream	State Road	Moderate surface erosion, moderate road shoulder erosion.	Grade the road shoulder and divert runoff further upstream by installing a turnout. Add trees to the Buffer.	2	3	Medium

Site	Location	Direct Flow to	Land Use	Issues	Recommendations	Impact High = 3 Med = 2 Low = 1	Cost High = 3 Med = 2 Low = 1	Technical Level
1-30	Suissevale Beach and Marina	Lake	Boat Access	Lack of shoreline vegetation around marina.	Create a vegetated buffer at far end of parking lot and around island as much as possible.	3	3	High
1-59	Lee Road	Stream	Residential	Inadequate shoreline vegetation and shoreline erosion.	Establish buffer and add to existing buffer. Stop mowing.	2	3	Low
1-24	Blackbird Lane #14	Stream	Private Road	Moderate road shoulder erosion.	Establish a vegetated buffer at the end of the road.	2	2	Low